Dear Sir or Madam

It has come to our attention that misunderstandings have occured regarding piston cleaning ring (PC ring) replacement when a liner is worn. The PC ring replacement instruction has therefore been updated.

The piston cleaning ring is installed to protect against excessive deposit build-up on the piston crown top land by scraping off the deposits when the piston approaches top dead center (TDC).

If deposits build up excessively on the top-land of the piston crown, it can have a negative influence on the cylinder condition. It is therefore not recommended to operate the engine without the PC ring installed.

For questions or inquiries regarding the content in this service letter, contact our Operation Department at: <u>Operation2S@man-es.com</u>

Yours faithfully

Mihuel Jehren

Mikael C. Jensen Vice President, Engineering

Stig B. Jakobsen Senior Manager, Operation

Action code: AT FIRST OPPORTUNITY

Piston cleaning ring

Update of the instruction for piston cleaning ring replacement Replacement of SL2016-620/AAB

SL2019-684/JAP November 2019

Concerns

Owners and operators of MAN B&W two-stroke marine diesel engines. Type: All MAN B&W engines fitted with piston cleaning ring.

Summary

Update of the instructions for operating the engine with a PC-ring when the liner is worn.

Other relevant Service Letters are: SL2000-382



Head office (& po. address) MAN Energy Solutions Teglholmsgade 41 2450 Copenhagen SV Denmark Phone: +45 33 85 11 00 Fax: +45 33 85 10 30 info-cph@man-es.com www.man-es.com

PrimeServ Teglholmsgade 41 2450 Copenhagen SV Denmark Phone: +45 33 85 11 00 Fax: +45 33 85 10 49 PrimeServ-cph@man-es.com Production Teglholmsgade 35 2450 Copenhagen SV Denmark Phone: +45 33 85 11 00 Fax: +45 33 85 10 17 manufacturing-dk@man-es.com

 Forwarding & Receiving

 Teglholmsgade 35

 2450 Copenhagen SV

 Denmark

 Phone: +45 33 85 11 00

 Fax: +45 33 85 10 16

 shipping-cph@man-es.com

MAN Energy Solutions

Branch of MAN Energy Solutions SE, Germany CVR No.: 31611792 Head office: Teglholmsgade 41 2450 Copenhagen SV, Denmark German Reg.No.: HRB 22056 Amtsgericht Augsburg

Introduction

The piston cleaning ring (PC ring) was introduced to the engine design to prevent excessive deposit build-up on the piston crown top land.

The PC-ring dimensions prevent excessive deposits on the top land by its inner diameter spacing the top land when the piston approaches TDC during each stroke.

The piston crown top land height has increased over time to secure the cylinder condition. Because of the increased top land dimensions, deposits on the top land have become more critical than for shorter top land engines.

Cylinder overhaul

The PC ring and cylinder liner are designed to always follow each other. Therefore, when a cylinder unit is overhauled, the PC ring must be inspected, cleaned and if intact, reused.

If the PC ring is removed from the liner for some reason, it is important to mark the correct position on the parts. The PC ring must be installed in the same position as when removed, because it is worn together with the cylinder liner.

Since the PC ring is worn to the same extent as the liner, it is not necessary to replace the PC ring during overhaul.

New liner

When installing a new liner, it is mandatory to install a new PC ring too.

Reconditioned liner

When installing a reconditioned liner (when the liner is worn beyond the defined critical dimension in the skirt TDC position) a PC ring must be installed which matches the new bore diameter, and it must follow the liner as they are a matched item.

Operation WITHOUT a PC ring (not recommended)

Since the function of the PC ring is to protect against deposits building up on the piston crown top land, operation without a PC ring can lead to excessive deposit formation on the top land. Deposits on the top land can have a negative impact on the condition of the unit. It may cause polishing of the liner surface and also lead to a lack of lubrication between the piston rings and liner, which eventually can result in piston ring or piston skirt scuffing.

A deposit build-up can also affect the position of the piston inside the cylinder and cause high friction between the liner and piston skirt. This situation may lead to severe damage of the liner and skirt, and must be avoided.

Operation without a PC ring cannot be recommended and is only allowed in emergency situations when no PC ring is available. The condition should be rectified as soon as possible.

Instruction book

A review of our previous instruction for cylinder overhaul and PC ring evaluation has deemed it necessary to send out this update, and to give the clear instruction not to remove the PC ring unless it is damaged to an extent where it can no longer be used. The revised instruction has been included on pages 3 and 4.

If the PC ring has to be renewed because of damage, a new one can be fitted to a worn liner provided that the liner wear in the piston skirt TDC position is less than 0.1% of the bore diameter. The instruction on pages 3 and 4 shows the definition of the skirt TDC position and how to measure it.

Note, that the evaluation of the liner wear must NOT be based on the liner maximum wear but on the wear measured in the the piston skirt TDC.

If the PC ring is broken or damaged and the liner wear exceeds 0.1% in the piston skirt TDC position, please contact MAN Energy Solutions for further guidance.

If for some reason it is not possible to exchange the liner, MAN Energy Solutions should be consulted for guidance on how to proceed.



MAN Energy Solutions

MAN Energy Solutions

2265-2207-0001

-	4	. Piston Skirt TDC	In addition to the measuring points	
Checking			visible on the cylinder liner measuring tool, measurements must also be taken at the Piston Skirt TDC posi- tion.	
			The Piston Skirt TDC position is loc- ated X mm below the wear ridge cre- ated at the top piston ring TDC. For calculation of X see step 2 "Piston Skirt Check Distance".	
			Using a paint marker or similar make a mark at the Piston Skirt TDC posi- tion and measure the liner diameter in this position for calculation of liner wear.	2265-0601-0031C05
	 5. Piston cleaning (PC) ring When removing the piston cleaning (PC der cover, make sure to mark the positi PC-ring in the same position as it is wo The PC-ring is to be regarded as an intraded to follow the service life of the liner. During inspection of the piston and the spected. 		ing between the liner and the cylin- of the ring to allow fitting of the together with the liner.	
			rated part of the liner and it is inten-	
			During inspection of the piston and the lin spected.	piston and the liner, the PC-ring must also be in-
			For the piston cleaning ring measurements, see Data T22-108 and T22-109	
			NOTE !	
			 If the PC-ring is undamaged, re-moun the original position (Scratch marks, m 	t the PC-ring in the cylinder liner in nade before removal, must align).
			 If the PC-ring is broken or cracked and at the Piston Skirt TDC position) is bell replace the PC-ring with a new standard 	d the cylinder liner wear (measured ow 0.1% of the nominal diameter, ard PC-ring.
			 If the PC-ring is broken or cracked and at the Piston Skirt TDC position) is abo contact MAN Energy Solutions. 	d the cylinder liner wear (measured we 0.1% of the nominal diameter,
ing Ring			When a new cylinder liner is installed, a new When a new liner is ordered, a new PC-rin	ew PC-ring must also be installed. ng must also be ordered.
iston Clear	ork Card			
Δ_	3			

2 (2)

2265-2207-0001

MAN